



PRO SPEC
CHARGER PORT REPLACEMENT
PART NUMBER:W15128501106

Required Tools: (Not included)


- Flat Screwdriver
- Phillips Screwdriver

⚠ WARNING

⚠ CAUTION: To avoid potential shock or other injury, turn power switch OFF and disconnect charger before conducting any assembly or maintenance procedures. Failure to follow these steps in the correct order may cause irreparable damage.

Step 1

Using a Phillips screwdriver, remove ten (10) screws from the left battery cover.

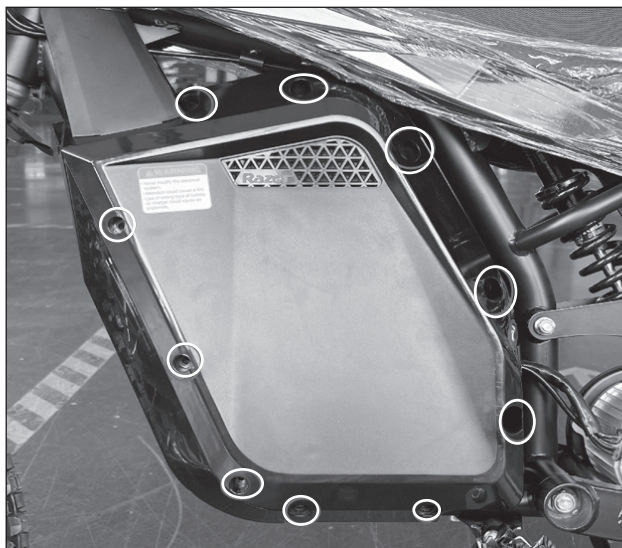


Step 2

Using a Phillips screwdriver, remove one (1) screw from the front battery cover.




Step 3

Remove the left battery cover and set it aside.

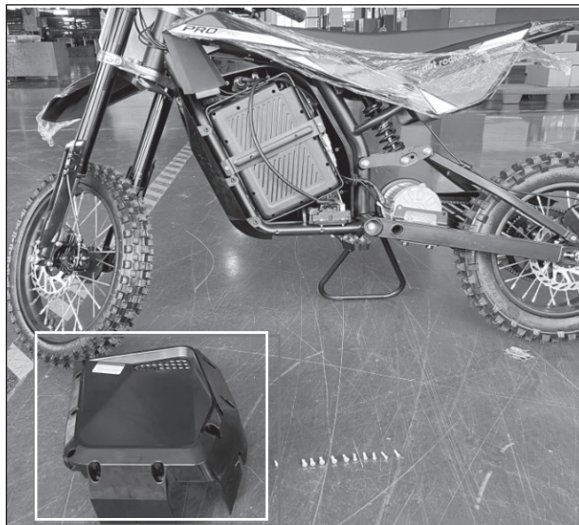

Step 4

Disconnect the battery connector.

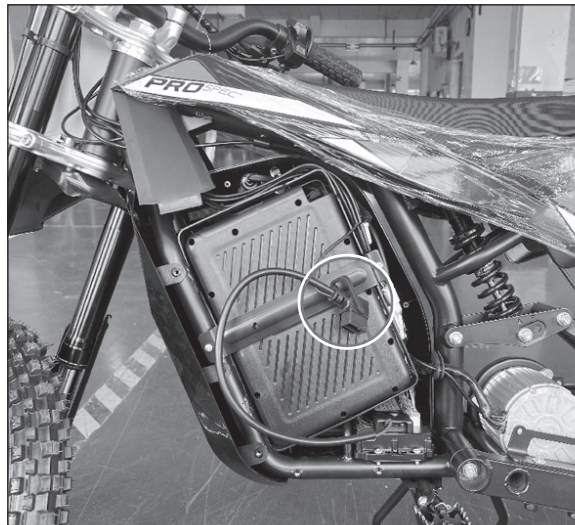

Step 5

Using a Phillips screwdriver, remove five (5) screws from the right battery cover.



Step 6

Using a Phillips screwdriver, remove one (1) screw from the front battery cover.




Step 7

Remove the front battery cover and set it aside.




Step 8

Disconnect the charger port plug and the power switch plug, then remove the right battery cover.

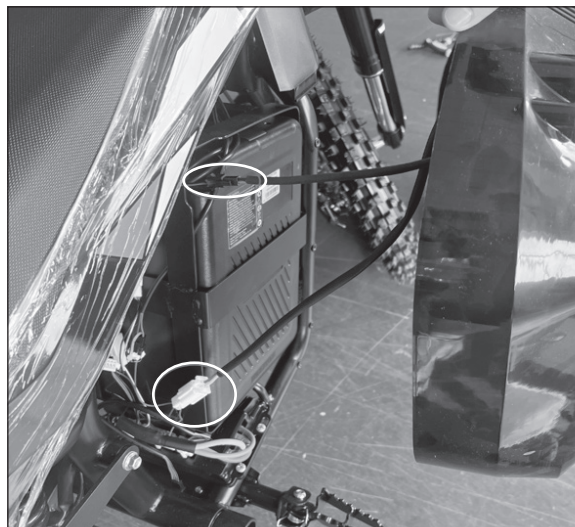


Step 9

Using a Phillips screwdriver, remove two (2) screws from the front of the charger port.

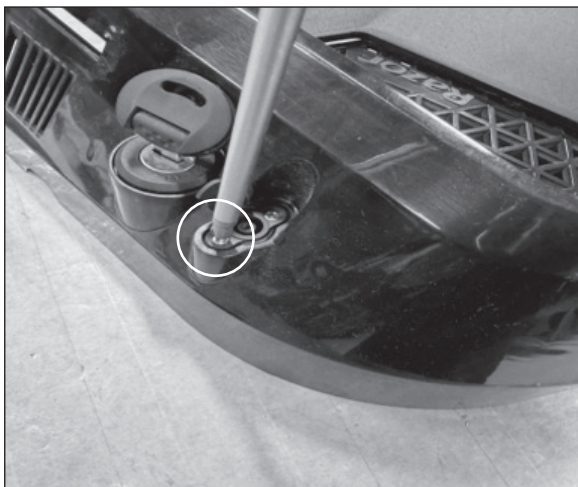

Step 10

Using a flat screwdriver, remove the glue from the back of the charger port. Carefully pull the port out from the battery cover.

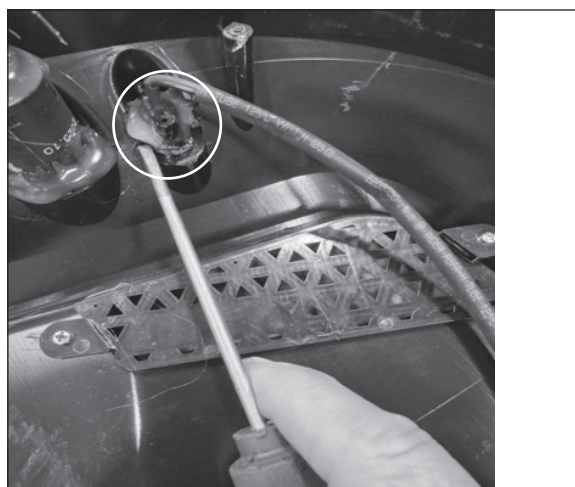

Step 11

Insert a new charger port, then reverse steps 1 through 10.

ATTENTION: Charge battery 12 hours before using.